

Isle of Man Ship Registry Port State Control Notice

January 2023 PSC Analysis

Ref: 02-2023

Issued: 15 February 2023

1. Introduction

This notice serves to highlight shipowners of recent trends identified following Port State Control Inspections performed across all Manx flagged vessels for January.


The top risk areas identified during this month were:

- Emergency Systems
- Fire Safety
- Certificates & Documentation

The Ship Registry advises owners to place particular emphasis on these risk areas during their own inspections to minimise issues during Port State Control. Any concerns/issues following Port State Control should be highlighted to the Ship Registry as soon as possible.

2. PSC Deficiencies – All PSC MoU Regions

The following chart shows deficiency areas requiring corrective action raised in all MoU Regions as a percentage of total deficiencies recorded:

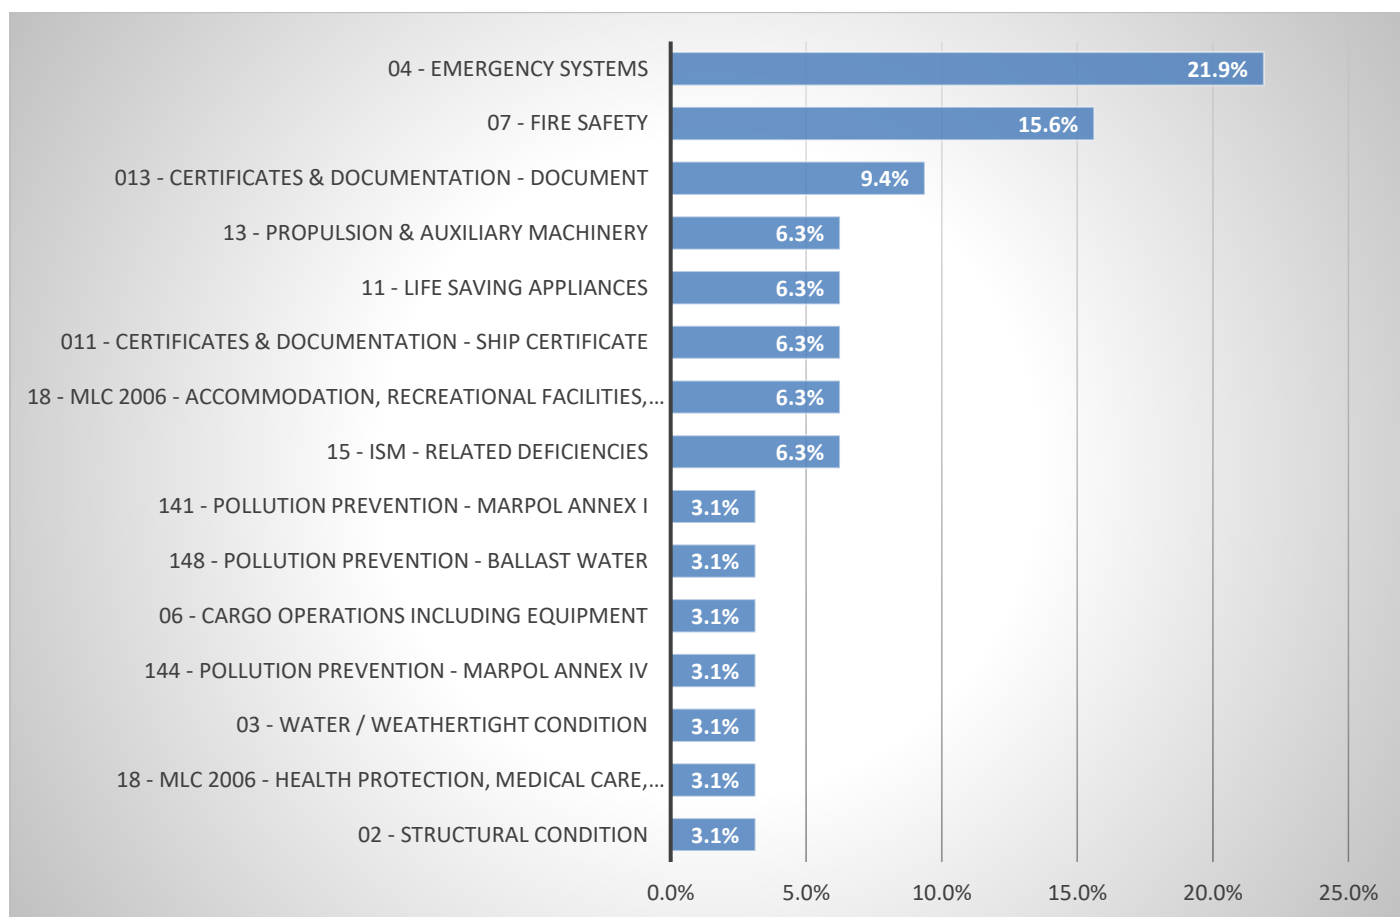

3. PSC Deficiencies by Ship Type – All PSC MoU Regions

The following table shows deficiency items raised by code (Paris MoU coding system) by ship type in all MoU regions.

Deficiency Heading	Bulk Carrier	Oil Tanker	Gas Carrier	Cargo Ship	OSV
011 - Certificates & Documentation - Ship Certificate	0	0	0	2	0
013 - Certificates & Documentation - Document	1	0	0	1	1
02 - Structural Condition	1	0	0	0	0
03 - Water / Weathertight Condition	1	0	0	0	0
04 - Emergency Systems	4	1	0	2	0
06 - Cargo Operations including Equipment	0	0	0	1	0
07 - Fire Safety	1	1	0	2	1
11 - Life Saving Appliances	2	0	0	0	0
13 - Propulsion & Auxiliary Machinery	2	0	0	0	0
141 - Pollution Prevention - MARPOL Annex I	0	0	1	0	0
144 - Pollution Prevention - MARPOL Annex IV	0	0	0	1	0
148 - Pollution Prevention - Ballast Water	1	0	0	0	0
15 - ISM - Related deficiencies	0	1	1	0	0
18 - MLC 2006 – Accom., Rec. Facilities, Food & Catering	0	1	0	0	1
18 - MLC 2006 - Health Prot., Med. Care, Welfare and SS	1	0	0	0	0
Total	14	4	2	9	3

4. PSC Deficiencies – All

The following table shows all deficiencies raised to the IOM Ship Registry due to Port State Control during January.

Deficiency Heading	Code	Description	Deficiency Comment
011 - Certificates & Documentation - Ship Certificate	1124	International Air Pollution Prevention Certificate	IAPPC not as required
	1199	Other (certificates)	Not specified - Other certificates not as required
013 - Certificates & Documentation - Document	1340	Statements of Compliance (MARPOL Annex VI)	SoC MARPOL Annex VI not as required
	1315	Oil record book	ORB not completed with required entries correctly
	1320	Garbage record book	Garbage records not fully completed
02 - Structural Condition	2108	Electric equipment in general	Electrical systems to be in accordance with convention requirements
03 - Water / Weathertight Condition	3105	Covers (hatchway - portable - tarpaulins, etc.)	Hatchway not as required



04 - Emergency Systems	4110	Abandon ship drills	Abandon ship launching of survival craft has not been able to be conducted and to maintain crew experience under the requirement of SOLAS Chapter III/19.3.3.3/3.3.4;
	4107	Emergency towing arrangements	Towing arrangements to be satisfied as per manual
	4110	Abandon ship drills	Abandon ship drills not as required
	4110	Abandon ship drills	Drills to be conducted as required.
	4107	Emergency towing arrangements	Emergency towing not as required
	4103	Emergency lighting, batteries and switches	Low insulation resistance at 220V EDG feeder panel
	4114	Emergency source of power / Emergency generator	LO pressure gauge for EDG inoperative
06 - Cargo Operations including Equipment	6101	Cargo securing manual	Cargo found not lashed to trailer as required under the CSM
07 - Fire Safety	7105	Fire doors/openings in fire-resisting divisions	Self-closing fore doors to be closable
	7105	Fire doors/openings in fire-resisting divisions	Fire doors in galley not closing correctly
	7109	Fixed fire extinguishing installation	Co2 FFE system hose found not secured to Co2 bottle: Non return valves to be fitted to the manifold end of the hoses as per schematic diagram.
	7199	Other (fire safety)	Paint found in cargo vehicle deck
	7199	Other (fire safety)	Fire safety arrangements to be improved
11 - Life Saving Appliances	11101	Lifeboats	Unable to start LB engine within 2 minutes
	11104	Rescue boats	Drain valve for RB sump not as required.
13 - Propulsion & Auxiliary Machinery	13103	Gauges, thermometers, etc.	ME temperature sensor failure X-head bearing
	13108	Operation of machinery	Ballast pump inoperative
141 - Pollution Prevention - MARPOL Annex I	14119	Oil and oily mixtures from machinery spaces	Oil and oily mixtures from machinery spaces. Same deficiency already reported during the previous PSC in 2021.
144 - Pollution Prevention - MARPOL Annex IV	14499	Other (MARPOL ANNEX IV)	MARPOL Annex VI not as required



148 - Pollution Prevention - Ballast Water	14802	Ballast Water Record Book	BW records to be as required from the book
15 - ISM - Related deficiencies	15150	ISM	ISM Audit from Company within 90 days
	15150	ISM	Corrective action to be taken by the Company within 3 months.
18 - MLC 2006 - Accommodation, Recreational Facilities, Food & Catering	18314	Provisions, quantity - (food and drinking water supply)	Insufficient victuals for the voyage
	18312	Galley, Handling room - (maintenance)	Poor hygiene: galley tiles broken in galley
18 - MLC 2006 - Health Protection, Medical Care, Welfare and Social Security Protection	18414	Protection machines / parts	Protection of machinery parts not as required

